

ABLE EXTERMINATORS, INC.
P.O. BOX 5339
SAN JOSE, CALIFORNIA 95150
PHONE (408) 251-6500 - FAX# (408) 251-3652

INVOICE

11/05/21

| | | |
|--|---------------------------------|------------------------------|
| Bill To | | Invoice Number 189463 |
| George Sudol/Bay Area Realty Svs George@ba-realtyservices.co 00000 | | |
| Property Address | | Escrow Number |
| 21080 RAINBOW PL. CUPERTINO | | |
| Description | Inspection Number 173788 | |
| Termite Inspection and Report Fee 11/05/21 | | 375.00 |
| Termite Control Work Completed | | |
| Other: | | |
| Total | \$ | 375.00 |

Please return one copy of this invoice with payment.



PAID
Credit Card

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

| | | | | | |
|--------------|-------------|-----------|-------|--------------------|-----------------|
| Building No. | Street | City | Zip | Date of Inspection | Number of Pages |
| 21080 | RAINBOW PL. | CUPERTINO | 95014 | 11/05/21 | 10 |

ABLE EXTERMINATORS, INC.
P.O. BOX 5339
SAN JOSE, CALIFORNIA 95150
PHONE (408) 251-6500 - FAX# (408) 251-3652



| | | |
|--|---|-----------------|
| Registration # PR0176 | Report # 173788 | Escrow # |
| Ordered by: George Sudol/Bay Area Realty S George@ba-realtyservices.co 00000-0000 | Property Owner and/or Party of Interest: Sofya Morgan 21080 Rainbow Pl. Sofron52@hotmail.com Cupertino CA 95014-0000 | Report Sent to: |

☒ COMPLETE REPORT
☐ LIMITED REPORT
☐ SUPPLEMENTAL REPORT
☐ REINSPECTION REPORT

General Description:
Two story, single family residence.


Inspection Tags Posted:
Garage.

Other Inspection Tags:
None noted.

An inspection has been made of the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any structures not on the diagram were not inspected.

☒ Subterranean Termites
☐ Drywood Termites
☒ Fungus/Dryrot
☒ Other Findings
☒ Further Inspection

If any of the above boxes are checked, it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

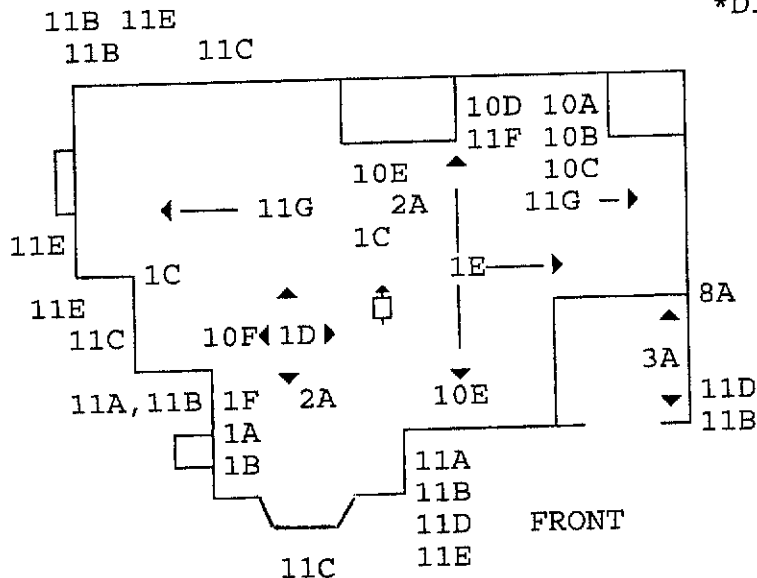

Inspected by **William Bossley**

State License No. **PR10557**

Signature Wm Bossley

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, California 95815.

NOTE: Questions or problems concerning the above report should be directed to the manager of this company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov. 43M-41 (Rev. 10/01)

| | | | | | |
|--------------|--------------|-----------|-------|--------------------|---------|
| Building No. | Street | City | Zip | Date of Inspection | Page |
| 21080 | RAINBOW PL., | CUPERTINO | 95014 | 11/05/21 | 2 of 10 |

SCOPE OF INSPECTION. IMPORTANT INFORMATION

This is a report of an inspection for wood destroying pests and organisms of an occupied, furnished structure. This inspection was of only the visible and accessible areas of the structure. This inspection and report does not reveal building code compliance or non-compliance. For information about code compliance, a company that makes structural home inspections should be engaged. We have not inspected areas under furnishings, appliances, storage or floor coverings nor did we inspect inside finished walls or ceilings. Inspection of these areas is not practical. Wood members above eight (8) feet in height were visually inspected only. If inspection of any of these areas is requested, we would perform that inspection for an additional charge. We did not inspect electrical, heating or mechanical systems nor did we inspect the plumbing systems except as may be specifically noted below. Inspection of these systems is beyond the scope of this inspection report. This inspection does not cover general pests that are not classified as wood destroying pests. Any mention of such, if applicable, is provided as a courtesy. For general pest control services please contact a specialist in that line of work. **THE EXTERIOR SURFACE OF THE ROOF WAS NOT INSPECTED. IF YOU WANT THE WATER TIGHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A ROOFING CONTRACTOR WHO IS LICENSED BY THE CONTRACTORS' STATE LICENSE BOARD.**

We were only able to inspect the second story eave areas visually from the ground. We did not inspect upstairs plumbing over finished ceilings for concealed water leakage or damage. Wood members above eight (8) feet in height were visually inspected only. The attic was not fully inspected due to insulation covering the lower wood members of the attic. Visual inspection from the access opening only, under limited lighting conditions, disclosed no evidence of infestations or adverse conditions. The bathroom and kitchen floor have ceramic tile installed. No adverse conditions are evident without disturbing the tile installation. We assume no liability for the condition of the floor under the tile unless we remove the tile. The area under the water heater pedestal was not inspected. The area beneath and behind the built-in cabinets in the garage was not inspected. The insulation in the substructure area limits our inspection to the visible and accessible portions of these areas. The enclosed areas inside the garage walls and ceiling were not inspected. Further inspection is recommended. If any of these areas become accessible or if concealed infestations or damage become evident after the date of our original inspection, we will issue a supplemental report with recommendations and costs for corrections.

WE GUARANTEE LOCAL TREATMENTS DONE BY THIS COMPANY FOR TWO YEARS FROM THE DATE OF COMPLETION. WE GUARANTEE WATER DAMAGE REPAIRS FOR THIRTY (30) DAYS FROM THE DATE OF COMPLETION. **FUMIGATIONS ARE GUARANTEED FOR FOUR (4) YEARS FROM THE DATE OF THE FUMIGATION.** WE CANNOT GUARANTEE WORK DONE BY THE OWNERS OR THE OWNERS' AGENTS. WE MAKE NO GUARANTEE AGAINST FUTURE INFECTIONS, ADVERSE CONDITIONS OR CONDITIONS PRESENT BUT NOT EVIDENT AT THE TIME OF OUR INSPECTION.

| | | | | | |
|--------------|--------------|-----------|-------|--------------------|---------|
| Building No. | Street | City | Zip | Date of Inspection | Page |
| 21080 | RAINBOW PL., | CUPERTINO | 95014 | 11/05/21 | 3 of 10 |

"NOTICE: REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS REGISTERED COMPANIES SHOULD LIST THE SAME FINDINGS (I.E. TERMITE INFESTATIONS, TERMITE DAMAGE, FUNGUS DAMAGE, ETC.). HOWEVER, RECOMMENDATIONS TO CORRECT THESE FINDINGS MAY VARY FROM COMPANY TO COMPANY. YOU HAVE A RIGHT TO SEEK A SECOND OPINION FROM ANOTHER COMPANY.

NOTE: This company will reinspect repairs done by others within four months of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of the request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs.

NOTE: THIS COMPANY WILL REINSPECT WORK PERFORMED BY OTHERS FOR A REINSPECTION FEE OF \$375.00. OPEN WALL AND OPEN FLOOR INSPECTIONS ARE REQUIRED IF A CERTIFICATION OF THOSE AREAS IS DESIRED FROM THIS COMPANY.

NOTE: IF, DURING THE PERFORMANCE OF ANY REPAIRS, OR REINSPECTIONS, BY THIS COMPANY, ANY INFESTATIONS OR INFECTIONS ARE REVEALED THAT WERE NOT EVIDENT AT THE TIME OF OUR ORIGINAL INSPECTION, WE WOULD ISSUE A SUPPLEMENTAL REPORT WITH FINDINGS, RECOMMENDATIONS AND ADDITIONAL COSTS FOR CORRECTIONS.

NOTE: THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I/SECTION II CONDITIONS EVIDENT ON THE DATE OF INSPECTION. SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION OR CONDITIONS THAT HAVE RESULTED IN OR FROM INFESTATION OR INFECTION. SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION OR INFECTION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND. FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE THE INSPECTION AND CANNOT BE DEFINED AS SECTION I OR SECTION II.

(1) SUBSTRUCTURE AREA

1A. FINDING: Infestation by drywood termites was noted at the subarea extending into inaccessible areas.

RECOMMENDATION: Due to the nature of these infestations, it will be necessary to seal the entire structure and fumigate it with Vikane (Sulfuryl Fluoride). Tear gas (Chloropicrin) will be used as a warning agent. The entire structure must be vacant for at least 48 hours for this process. All due caution will be used for the fumigation. However, Able Exterminators, Inc. and it's subcontractor's will not be liable for any damage to the roof coverings, solar panels, TV antennas or plantings adjacent to the structure.

SECTION I ITEM.

| | | | | | |
|--------------|--------------|-----------|-------|--------------------|---------|
| Building No. | Street | City | Zip | Date of Inspection | Page |
| 21080 | RAINBOW PL., | CUPERTINO | 95014 | 11/05/21 | 4 of 10 |

NOTE: It will be the owner's responsibility to ensure that all exterior openings (ie. ventilation and substructure access) are sealed prior to the fumigation start date. Able Exterminators, Inc. and it's subcontractor's assume no liability for accidental injury to pets or other animals while performing fumigation.

NOTE: Instructions for preparation work and additional costs, if any, will be forthcoming and must be complied with in order for fumigation to commence. The occupants must sign the Occupants Fumigation Notice and comply with all of the instructions. For fumigations that cancel within three business days or less will be charged a cancellation fee of \$200.00.

NOTE: Fumigations booked with this company are guaranteed for four (4) years from the date of completion.

1B. FINDING: Drywood termite pellets were evident at the subarea.
RECOMMENDATION: Remove or mask over all accessible termite pellets. It is possible for drywood termite pellets to sift down or reappear in these areas where they have been masked over. SECTION I ITEM.

1C. FINDING: There is a slight amount of cellulose debris in the substructure area in earth contact. Some of this debris has been infected by fungus.
RECOMMENDATION: Remove the cellulose debris of a size that can be raked from the substructure area. SECTION I ITEM.

1D. FINDING: Water marks on the foundation and other substructure members indicate that there has been standing water under this structure in the past. The substructure area soil is now damp to muddy.
RECOMMENDATION: Any buyer of this property should be aware that it is possible to have standing water under this structure during the winter months. The substructure area should be periodically checked and if the moisture in the substructure area creates a problem, we would issue a supplemental report with recommendations and additional costs for corrections. SECTION II ITEM.

1E. FINDING: Portions of the subarea are inaccessible due to muddy soil.
RECOMMENDATION: Further inspection recommended. The owner should wait until the substructure area dries out or have it pumped dry. In the event that it is not practical to wait until the substructure area dries out to complete the inspection, we would return with proper equipment and crawl the wet substructure area. There is an additional \$200.00 charge for crawling wet substructure areas. The wet substructure area charge is payable prior to the inspection.
UNKNOWN-FURTHER INSPECTION RECOMMENDED.

| Building No. | Street | City | Zip | Date of Inspection | Page |
|--------------|--------------|-----------|-------|--------------------|---------|
| 21080 | RAINBOW PL., | CUPERTINO | 95014 | 11/05/21 | 5 of 10 |

NOTE: ABLE EXTERMINATORS, INC., assumes no liability for any conditions outlined in Unknown-Further Inspection items unless they are performed as outlined in the report.

1F. FINDING: Fungus damage was found to approximately four feet of rim joist in the area indicated on the diagram.
 RECOMMENDATION: Open enough stucco from the exterior to expose all of the damaged wood members. Remove and replace the damaged rim joist as needed. Install new paper, wire and stucco where removed. The new stucco texture may vary from the existing. The owner is advised that stucco repairs are dependant on ambient outside temperatures and may take up to a week to complete. We will seal the area with one coat of primer. It will be the owner's responsibility to paint this area to match the existing area. If damage extends beyond the above outlined area or into inaccessible areas, a supplemental report will be issued with findings, recommendations and bids to complete repairs. SECTION I ITEM.

(2) STALL SHOWER

2A. FINDING: The wiper strip at the base of the shower door in the master bathroom and guest bathroom is deteriorated. This has not caused damage to the adjacent wood members.
 RECOMMENDATION: Replace the wiper strip as needed. If, for some reason, the wiper strip cannot be replaced without replacing the entire door, a supplemental report will be issued. SECTION II ITEM

(3) FOUNDATIONS

3A. FINDING: Water stains/efflorescence was noted on the foundation.
 RECOMMENDATION: The owner is to contact a licensed and qualified contractor to examine and make the necessary repairs or revisions. All guarantees pertaining to this item are to be secured from the person or firm which performs the repair. SECTION II ITEM.

(8) GARAGES

8A. FINDING: The side garage door has been damaged by fungus.
 RECOMMENDATION: Supply and install a new door. We intend to reuse the existing hardware and will paint the exterior of the new door with primer paint only. SECTION I ITEM.

(9) DECKS...PATIOS

NOTE: The rear patio cover was not connected to the structure; therefore, we do not include it in this report.

| | | | | | |
|--------------|--------------|-----------|-------|--------------------|---------|
| Building No. | Street | City | Zip | Date of Inspection | Page |
| 21080 | RAINBOW PL., | CUPERTINO | 95014 | 11/05/21 | 6 of 10 |

(10) OTHER...INTERIOR

10A. FINDING: There is a plumbing leak at the tub handle in the downstairs hall bathroom tub.
RECOMMENDATION: The owner should have a licensed plumber or someone in this line of work repair the leakage. Any guarantee desired should be secured from the party that actually performs the work. SECTION II ITEM.

10B. FINDING: The downstairs hall bathroom tub/shower window is below the showerhead. This creates an excessive moisture condition.
RECOMMENDATION: The owner is advised to install a water repellant curtain over this window to prevent moisture intrusion through the window frame. SECTION II ITEM.

10C. FINDING: The toilet in the downstairs hall bathroom is loose or improperly mounted.
RECOMMENDATION: Reinstall the toilet correctly using a new no-seep toilet seal. If upon removing the toilet a cracked toilet or improper hercules ring is revealed, there would be additional charges for a new toilet or repairs to the hercules ring. SECTION II ITEM.

10D. FINDING: There is loose/missing grout and cracked tiles at the kitchen counter.
RECOMMENDATION: The owner is to contact a licensed and qualified contractor to examine and make the necessary repairs or revisions. All guarantees pertaining to this item are to be secured from the person or firm which performs the repair. SECTION II ITEM.

10E. FINDING: Loose-missing grout at the dining room floor and entry was noted.
RECOMMENDATION: The owner is to contact a licensed and qualified contractor to examine and make the necessary repairs or revisions. All guarantees pertaining to this item are to be secured from the person or firm which performs the repair. SECTION II ITEM.

10F. FINDING: There is a plumbing leak at the tub handle in the master bathroom tub.
RECOMMENDATION: The owner should have a licensed plumber or someone in this line of work repair the leakage. Any guarantee desired should be secured from the party that actually performs the work. SECTION II ITEM.

NOTE: We observed the following conditions: Rust at the master bathroom sink. In our opinion, these are items of a maintenance nature and are not structural pest control problems. We mention them for information and to bring them to the owner's attention. The owner should have the proper trades person maintain and repair these areas.

| | | | | | |
|--------------|--------------|-----------|-------|--------------------|---------|
| Building No. | Street | City | Zip | Date of Inspection | Page |
| 21080 | RAINBOW PL., | CUPERTINO | 95014 | 11/05/21 | 7 of 10 |

(11) OTHER...EXTERIOR

NOTE: We observed the following conditions: Stress cracks at the stucco. In our opinion, these are items of a maintenance nature and are not structural pest control problems. We mention them for information and to bring them to the owner's attention. The owner should have the proper trades person maintain and repair these areas.

11A. FINDING: The fascia has been damaged by fungus at the area indicated on the diagram.

RECOMMENDATION: Remove and replace the damaged wood members; paint the repaired areas with primer paint only.
SECTION I ITEM.

NOTE: The gutters will need to be removed in order to perform repairs outlined in this report. It will be the owner's responsibility to have the gutters reinstalled upon completion of our repairs.

11B. FINDING: In connection with the wood repairs outlined in recommendation 11A and 11D, the roof covering will be damaged.

RECOMMENDATION: Upon completion of our wood repairs, the roof covering will be damaged. It will be necessary for the owner, upon completion of our wood repairs, to have a roofing contractor or someone in this line of work repair the roof covering as necessary. Any guarantee against leakage through the roof covering should be secured from whoever does this roof covering repair. Our bid does not include any roof covering repair costs. SECTION I ITEM.

NOTE: If a roofing certification is required for this item, it should be secured from a licensed roofing contractor.

11C. FINDING: The window trim has been damaged by fungus at the area indicated on the diagram.

RECOMMENDATION: Remove and replace the damaged wood members; paint the repaired areas with primer paint only.
SECTION I ITEM.

11D. FINDING: The eave boards have been damaged by fungus at the area indicated on the diagram.

RECOMMENDATION: Remove and replace the damaged wood members; paint the repaired areas with primer paint only.
SECTION I ITEM.

11E. FINDING: The rafter has been damaged by fungus at the barge rafter.

RECOMMENDATION: Remove and replace the damaged wood members; paint the repaired areas with primer paint only.
SECTION I ITEM.

| Building No. | Street | City | Zip | Date of Inspection | Page |
|--------------|--------------|-----------|-------|--------------------|---------|
| 21080 | RAINBOW PL., | CUPERTINO | 95014 | 11/05/21 | 8 of 10 |

11F. FINDING: The rain gutters and/or downspouts are leaking.
RECOMMENDATION: The owner should have the appropriate trades repair the gutters and downspouts in the most practical way.
SECTION II ITEM

11G. FINDING: Weathering and staining at the second story eaves at the rear.
RECOMMENDATION: The owner is to contact a licensed and qualified contractor to examine and make the necessary repairs or revisions. All guarantees pertaining to this item are to be secured from the person or firm which performs the repair. SECTION II ITEM.

NOTE: IF, DURING THE PERFORMANCE OF ANY TREATMENTS, REPAIRS, OR REINSPECTIONS BY THIS COMPANY, ANY DAMAGE, INFESTATIONS, INFECTIONS, PLUMBING LEAKS OR FAULTY FIXTURES ARE REVEALED THAT WERE NOT EVIDENT AT THE TIME OF OUR ORIGINAL INSPECTION OR EXTEND INTO CURRENTLY INACCESSIBLE AREAS, WE WOULD ISSUE A SUPPLEMENTAL REPORT WITH FINDINGS, RECOMMENDATIONS AND ADDITIONAL COSTS FOR CORRECTIONS. OUR BIDS DO NOT INCLUDE THE COSTS OF PERMITS. IF ANY PERMIT BECOMES REQUIRED OR DESIRED IT WILL BE AN ADDITIONAL COST.

NOTE: If a complete certification is desired from this company, all Section I items would have to be completed.

NOTE: This Wood Destroying Pests & Organisms Report DOES NOT INCLUDE MOLD or any mold like conditions. No reference will be made to mold or mold like condition. Mold is not a Wood Destroying Organism and is outside the scope of this report as defined by the Structural Pest Control Act. If you would like your property to be inspected for mold or mold like conditions, please contact the appropriate mold professional.

NOTE: You must read and understand the scope of inspection and report. If you do not agree with and understand the scope of inspection, do not use this report for any purpose. Contact our office for further information.

NOTE: ABLE EXTERMINATORS, INC., assumes no liability for any conditions outlined in Unknown-Further Inspection items unless they are performed as outlined in the report.

| Building No. | Street | City | Zip | Date of Inspection | Page |
|--------------|--------------|-----------|-------|--------------------|---------|
| 21080 | RAINBOW PL., | CUPERTINO | 95014 | 11/05/21 | 9 of 10 |

NOTE: The charge for service that this company subcontracts to another person or entity may include the company's charge for arranging and administering such services that are in addition to the direct cost associated with paying the subcontractor. You may accept Able Exterminators, Inc.'s bid or you may contract directly with another registered company licensed to perform the work. If you choose to contract directly with another registered company, then Able Exterminators, Inc. will not be responsible for any act or omission in the performance of work that you directly contract with another to perform. Fumigations are subcontracted by Able Exterminators, Inc. to Best Care Fumigation. P.O. BOX 14461 Fremont, CA 94539 at (510) 226-1928.

NOTE: "State law requires that you be given the following information: CAUTION-PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on existing scientific evidence these are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degrees of exposure, so exposure should be minimized."

"If, within 24 hours following application, you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center 1-800-876-4766 and your pest control company immediately."

"For further information, contact any of the following: Your Pest Control Company (408) 251-6500; for Health Questions-The County Health Department (408) 299-5822; for Application Information-The Santa Clara County Agricultural Commissioner (408) 918-4600 or the Alameda County Agricultural Commissioner (510) 670-5232 and for Regulatory Information-the Structural Pest Control Board (800) 737-8188 located at 2005 Evergreen Street, Suite 1500, Sacramento, Ca 95815-3831".

NOTE: NOTICE TO CUSTOMERS AND BUYERS HAVING REPAIRS DONE - SOME RESIDENTIAL STRUCTURES ARE CONSTRUCTED WITH MATERIAL THAT MAY CONTAIN MATERIAL MANUFACTURED WITH ASBESTOS. OUR COMPANY IS NOT QUALIFIED OR CERTIFIED TO IDENTIFY THESE MATERIALS. IF THE OWNER OR INTERESTED PARTIES ARE AWARE OF, INTERESTED IN, OR CONCERNED ABOUT THIS CONDITION, THEY SHOULD CONTACT THE APPROPRIATE AGENCIES THAT ARE QUALIFIED OR CERTIFIED IN THIS FIELD.

"WARNING: Areas of wood being repaired by this company to residences contain a chemical known to the State of California to cause birth defects or other reproductive harm. Drilling, sawing, sanding or machining wood products generates wood dust, a substance known to the State of California to cause cancer"

| Building No. | Street | City | Zip | Date of Inspection | Page |
|--------------|--------------|-----------|-------|--------------------|----------|
| 21080 | RAINBOW PL., | CUPERTINO | 95014 | 11/05/21 | 10 of 10 |

NOTE: WARNING: Repairs by this company to residences built **before** 1978 may disturb materials containing lead-based paint and may release debris or dust containing lead. Lead is a chemical known to the State of California to cause cancer and birth defects or other reproductive harm. (This notice is provided in compliance with California's Proposition 65. For further information contact your health care provider or an industrial hygienist. A licensed pest control inspector is the not an expert in lead, lead-based paint or exposure to lead. This report is not intended to identify the presence or absence of lead or lead-based paint in the building inspected. Whether lead based paint is present can be determined only by a certified lead inspector. For a list of certified lead inspectors; call the California Department of Health Services Lead-Related Construction Information Line at 800-597-5323 or 510-869-3953)

ABLE EXTERMINATORS, INC.

P.O. BOX 5339 SAN JOSE, CA. 95150

Phone 1.408.251.6500

WORK AUTHORIZATION CONTRACTEmail ablexterm@aol.com

Fax 1.408.251.3652

This is a contract between Able Exterminators, Inc. and Sofya Morgan
and incorporates Able's termite report # 173788 dated 11/05/21 for real property located at
21080 RAINBOW PL., CUPERTINO

ITEMIZED COST BREAKDOWN (Refer to items on the report)

The cost of each item on this report is:

SECTION 1: 1A. 3300.00 1B. 150.00 1C. 395.00 1F. 1125.00 8A. 850.00
11A. 1625.00 11B. By Owner 11C. 825.00 11D. 1875.00 11E. 1659.00
*** TOTAL SECTION 1 ITEMS = \$11804.00

SECTION 2: 1D. By Owner 2A. 390.00 3A. By Owner 10A. By Owner 10B. By Owner
10C. 275.00 10D. By Owner 10E. By Owner 10F. By Owner 11F. By Owner
11G. By Owner
*** TOTAL SECTION 2 ITEMS = \$ 665.00

FURTHER INSPECTION: 1E. 150.00

We have not quoted, nor included, a price of "owner" items. Time and material prices are based on \$65.00 per man-hour portal to portal, and material at Able's cost plus 20 per cent. ITEMS ON THE REPORT MAY CONTAIN PROVISIONS FOR ADDITIONAL COSTS OVER AND ABOVE THE ORIGINAL ESTIMATE.

Please read the report carefully and completely.

CONDITIONS:

1. Time is of the essence in this contract. If Able's offer is not accepted within 45 days of the date of the report Able reserves the right to increase prices.
2. If further inspection is recommended, or if additional work is required by any Government agency, Able reserves the right to increase prices.
3. Notice to owner of Mechanic's Lien: Under the California Mechanics Lien Law, any structural pest control operator who contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your contractor in full if the subcontractor laborers or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". General contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.
4. TERMS OF PAYMENT. Accounts are past due thirty days after date of completion. Interest, at the maximum legal rate, will be charged on all past due accounts. In the event that legal action is necessary to enforce the terms of this contract, collection fees, attorney's fees and costs of suit will be awarded to the prevailing party.
5. SEND BILL TO: Name: _____ Address: _____
Phone: _____ Email: _____ Company: _____
Escrow number: _____ Estimated COE: _____

We understand that all invoices are due and payable immediately upon issue, regardless of delays in escrow.

6. We authorize Able Exterminators, Inc. to perform the following items:

_____ for a contract price of _____.

NAME OF PERSON TO CONTACT FOR ACCESS: _____

HOME PHONE: _____ WORK PHONE: _____

IS UPGRADING OR CHOICE OF LINOLEUM OR TILE COLOR DESIRED? Yes ___ No ___

There will be additional charges for special material chosen. If no choice, neutral colors will be installed.

The undersigned assumes financial responsibility for the amount of all invoices associated with this account.

SIGNED: _____ DATE: _____

PRINT NAME: _____